



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	358	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	4	Setup No:	9	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
1701		Regent	ROAD		
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	400		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 617

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-3\PLAYER_A\A_2004_1026Image0617.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9
358

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1605
Crew: T3	Street Location: SMITH AVE		
US MH: 0691704	DS MH: 0692151	Number of Segments: 6 +	Test Length: 1026'
Plugged US: Y <input checked="" type="radio"/> N	Plugged DS: Y <input checked="" type="radio"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? Y <input checked="" type="radio"/> N	Recorder: JMM	Comments: CWF 0691545, 0691548, 0691695	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

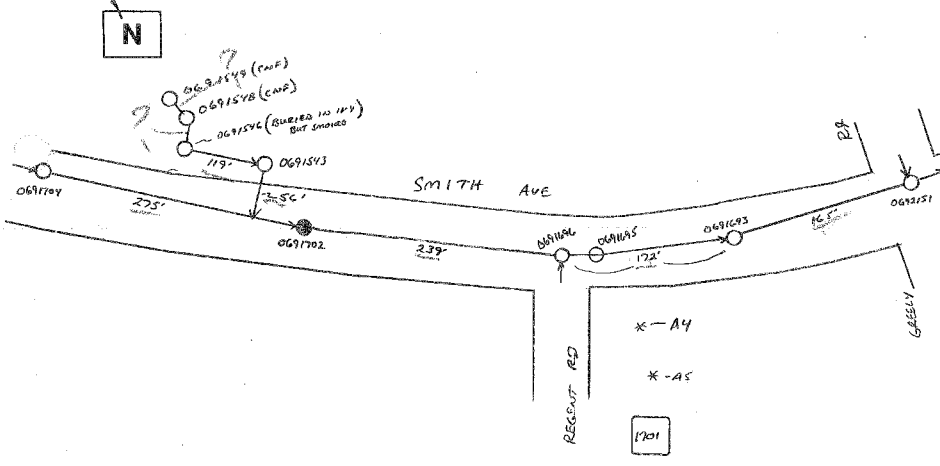

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 358

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\358.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	358	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	5	Setup No:	9	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1700		Regent	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 9
358

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1605
Crew: T3	Street Location: SMITH AVE		
US MH: 0691704	DS MH: 0692151	Number of Segments: 6 +	Test Length: 1026'
Plugged US: Y <input checked="" type="checkbox"/> N	Plugged DS: Y <input checked="" type="checkbox"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? Y <input checked="" type="checkbox"/> N	Recorder: JMM	Comments: CWF 0691545, 0691548, 0691695	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

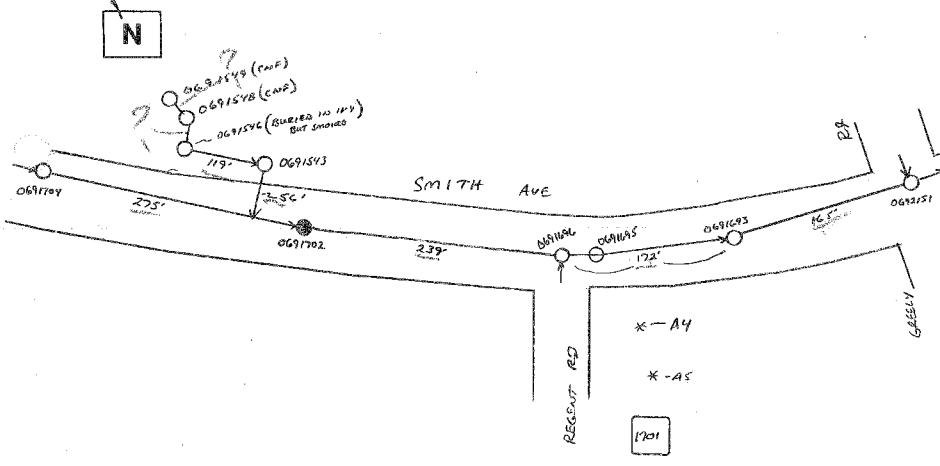

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 358

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\358.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	359	Date:	10/26/2004	MeterBasin:	02_33S
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	10	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5701		Newbury	St

Source Type:	12= MH Frame Seal	Location:	11=Field	Severity:	4=Major
Sector:	1=Public	Drainage Area:	200		

Comments: MH M1674 - Unmapped manhole

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 618

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-3\PLAYER_A\A_2004_1026Image0618.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 10
359

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1705
Crew: T3	Street Location: SMITH AVE + NEWBURY ST		
US MH: 0692151	DS MH: 0691162	Number of Segments: 1	Test Length: 594'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y N	Recorder: [Signature]	Comments: 069155Y CUP	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

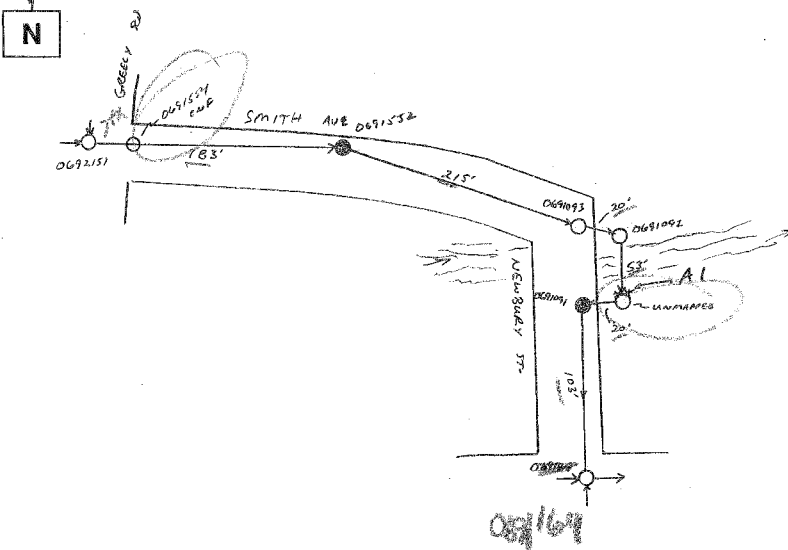

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No: 359

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\359.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	359	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	10	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
5707		Smith	AVE

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
---------------------	-----------	------------------	----------	------------------	------------

Sector:	2=Private	Drainage Area:	0
----------------	-----------	-----------------------	---

Comments: no vent pipe smoke

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 10
359

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1705
Crew: T3	Street Location: SMITH AVE + NEWBURY ST		
US MH: 0692151	DS MH: 0691162	Number of Segments: 1	Test Length: 594'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y N	Recorder: SP22	Comments: 069155Y CUP	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

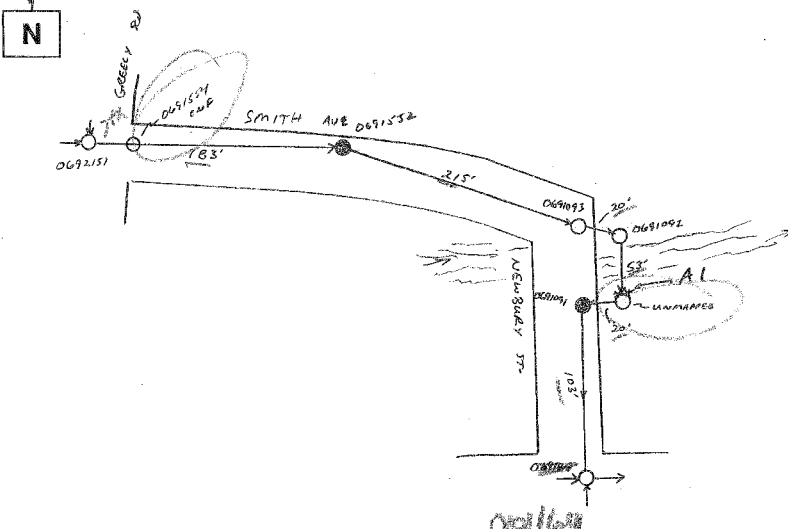

CREW COMMENTS

Last Revised 9/16/2004

Leader Form

Sketch No: 359

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\359.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	360	Date:	10/26/2004	MeterBasin:	01_WRR01
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	1	Setup No:	11	Priority CCTV:	
House Number	1804	Street Prefix:		Street Name:	
				Fairbank	
				ROAD	
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	200		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 619

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1026-2004\T-3\PLAYER_A\A_2004_1026Image0619.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 16
Setup No. 11
360

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1735
Crew: T3	Street Location: REGENT RR + FAIRBANK RD		
US MH: 0691701	DS MH: 0691696	Number of Segments: 6	Test Length: 775'
Plugged US: <u>Y</u> <u>N</u>	Plugged DS: <u>Y</u> <u>N</u>	# of Blowers: <u>1 2 3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? <u>Y</u> <u>N</u>	Recorder: <u>JMM</u>	Comments: CNF 0691700 OR 0691227	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, blgds & street addresses, sandbag locations, etc.)

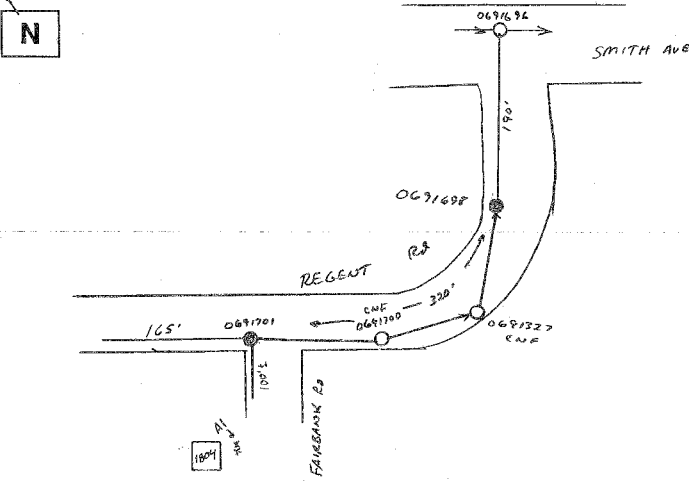

CREW COMMENTS

• SMOKE WAS NOT GETTING BETWEEN 0691701 + 0691698, SO WE BLEW SMOKE FROM BOTH.

Last Revised 9/16/2004 Leader Form

Sketch No: 360

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\360.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	360	Date:	10/26/2004	MeterBasin:	01_WR09
Observer ID:	A	Crew:	T-3	Dye Test Recommended:	N
Defect No:	2	Setup No:	11	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
1700		Regent	ROAD

Source Type:	18= Other	Location:	14=Other	Severity:	1=No Smoke
Sector:	2=Private	Drainage Area:	0		

Comments: no vent smoke

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH


Page 1 of 2
Smoke Set No. 16
Setup No. 11

360

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10-26-04	Start Time: 1735
Crew: T3	Street Location: REGENT RR + FAIRBANK RD		
US MH: 0691701	DS MH: 0691696	Number of Segments: 6	Test Length: 775'
Plugged US: <u>Y</u> <u>N</u>	Plugged DS: <u>Y</u> <u>N</u>	# of Blowers: <u>1 2 3</u>	Ground: <u>Dry</u> Moderate Wet
Plugs Removed? <u>Y</u> <u>N</u>	Recorder: <u>SMH</u>	Comments: CNF 0691700 OR 0691227	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, blgds & street addresses, sandbag locations, etc.)

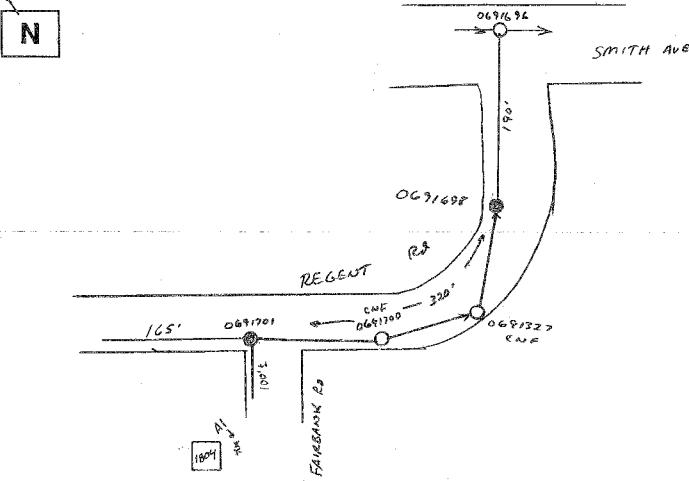

CREW COMMENTS

• SMOKE WAS NOT GETTING BETWEEN 0691701 + 0691698, SO WE BLEW SMOKE FROM BOTH.

Last Revised 9/16/2004 Leader Form

Sketch No: 360

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\360.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.